


Pro'sKit®



MT-3100

3 1/2 Leakage Current Clamp Meter

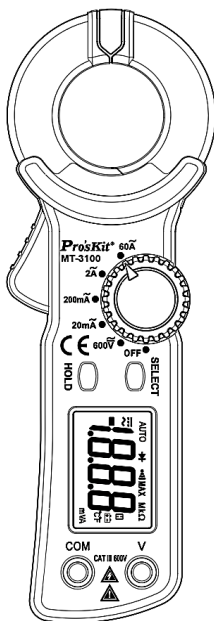

User's Manual

1st Edition,

©2026 Copyright by Prokit's Industries Co., Ltd.

1. Safety Information



Special attention should be paid when using the meter, improper use might cause an electric shock or damage the meter. General safety procedures shall be followed during the use and safety measures regulated by the instruction manual shall be completely respected.

To fully make use of the functions of the meter and ensure safe operation, please carefully read and follow the use method of this manual.

The meter meets IEC-61010-1, IEC-61010-2-032) Safety Requirements for Electronic Measuring Instruments of the secondary pollution; over-voltage standard is CAT II 600V.

Please follow the safe operation guidance and ensure using the meter is safe.

1.1 Preparations

- When use the meter, users must comply with the standard safety rules:
 - General protection against electric shock
 - Prevent misuse of the meter
- After receiving the meter, check if it has been damaged during the delivery.
- After been kept and delivered in shoddy conditions, check and confirm if the meter is damaged or not.
- The test lead must be in good condition. Before use, check the test leads to seeing if any damage caused to the insulation or if the metal wire of the cable is bare.
- Make sure the input voltage is less than 600V.
- 36V and less is the safety voltage and when measure the DCV more than 36V and ACV 25, please check the test leads if they are ok in connection and insulation to avoid the electric shock.

1.2 Marks

	Note (important security information, see the Instruction Manual)
	It can be used on hazardous live conductors.
	Double insulation protection (Category II)
CAT II	Follows the over-voltage (Setup) level II of IEC-61010-1 standard and pollution degree 2, which means the impulse withstand voltage level of protection provided.
CE	In line with the European Union (EU) Standard

1.3 Maintenance

- Please do not attempt to open the bottom case to adjust or repair the meter; such


operation could only be performed by technicians fully aware of the meter and the risk of electric shock.

- Before opening the meter case or battery cover at the end, the test lead should be removed from the circuit being measured.
- To avoid electric shock that might be caused by erroneous readings, when the meter displays "⎓" symbol, the battery should be replaced immediately.
- Use a damp cloth and mild detergent to clean the meter; do not use abrasive cleaning agents or solvents.
- Power supply of the meter should be turned off when not in use while range switch to the OFF position.
- If the meter is not used for a long time, batteries should be removed to prevent damage to the meter.

2. Descriptions

2.1 Part Name

- ① Current clamp head: used for measuring current
- ② Trigger
- ③ Rotary switch
- ④ Function Selection button
- ⑤ Data hold button
- ⑥ Display screen
- ⑦ Input socket

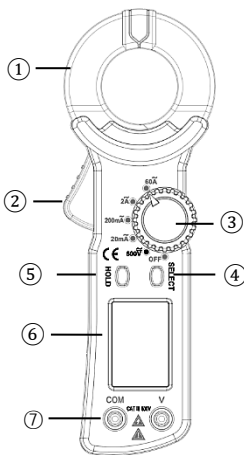

2.2 LCD Display Unit

$\overline{\text{DC}}$ $\sim$ AC	DC, AC voltage or Ampere
⎓	Low battery
⏻	Readings hold status
V	Volt (voltage),
A	Ampere (current)

3. Specifications

3.1 Overview

- Maximum allowable voltage between the measuring terminal and the Earth: 600V DC or 600V AC
- Work height: Maximum 2000m
- Display: LCD
- Maximum display value: 1999.
- Max jaw distance: D=30mm.
- Polar indication: Automatically indicate “-” means negative polarity.
- Over range Indication: 0L’ or ‘-0L’.
- Sampling time: About 3 times/s
- Automatic power off: no operation more than 15 mins
- Power supply: 1.5V AAA battery ×2
- Battery low voltage indication: LCD display  symbol.
- Temperature coefficient: $< 0.1 \times \text{Accuracy} / ^\circ\text{C}$
- Working Environment: $0^\circ\text{C} \sim 40^\circ\text{C}$, $\leq 70\% \text{RH}$
- Store Environment : $-20^\circ\text{C} \sim 50^\circ\text{C}$, $\leq 85\% \text{RH}$
- Body Size : 183×63×29 (mm)
- Net Weight : 136g (battery excluded)

3.2 Technical Index

Accuracy: ($\pm \% \text{read} \pm \text{digits}$)

one year is ensured Environment temperature: $23^\circ\text{C} \pm 5^\circ\text{C}$ $< 75\% \text{RH}$.

➤ AC Current

Measurement range	Resolution	Accuracy
20mA	0.01mA	$\pm (2.5\% \text{ reading} + 5 \text{ digits})$
200mA	0.1mA	
2A	0.001A	
60A	0.1A	$\pm (3\% \text{ reading} + 8 \text{ digits})$

Minimum input current: 0.1mA AC current; Maximum input current: 60A AC current

Frequency response: 45Hz-400Hz,

➤ DC / AC Voltage

Measurement range	Resolution	Accuracy
DC 600V	1V	$\pm (1.5\% \text{ reading} + 5 \text{ digits})$
AC 600V	1V	$\pm (1.5\% \text{ reading} + 5 \text{ digits})$

Minimum input voltage: 5V; Maximum input voltage: 600V DC/AC

AC Frequency response: 45Hz-1kHz,

4. Operation Guide

4.1 Measurement Preparations

Turn the rotary switch to the desired measurement position, turn on the power. If the battery voltage is low (of about $\leq 2.4V$), the LCD will show "  " symbol, then the battery shall be replaced.

4.2 Readings Hold

During the measuring process, if the readings are required to hold, press "Hold" button, the display value will be locked, press "Hold" button again to cancel readings hold.

4.3 Auto Power Off

- 1) If the meter is power on without any operation after 15 minutes, it will go into hibernation and automatically shut down to save power. Press any button to wake the meter into working status.
- 2) Press HOLD button and turn on the meter to disable automatic shutdown function.

4.4 Alternative leakage current measurement and Three-phase unbalanced current measurement.

1) Alternative leakage current measurement

 
check the leakage current of the ground lead: first transfer to the high range of ACA and jaw the ground lead to read. If the reading is relatively small, then transfer to a lower range. The reading is the leakage current of the found lead.

2) Three-phase unbalanced current.


check the leakage current of the unbalance working power line: jaw the power line(single-phase alternative current "two", three phase three-wire system "3", three phase four-wire system "4", do not jaw the ground line together if there is a one.

Notes: Many factories and companies use the three-phase and five-wire system with three-phase line and one working zero line and ground lead. While checking the leakage current, the ground line should be tested alone.

(1) single-phase alternative current





 (2) three phase three-wire system



(3) three phase four-wire system

 (4) three phase five-wire system

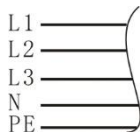

note: **L** is live wire **N** is zero line **PE** is ground line

4.5 ACA measurement

When checking the ACA, first transfer to the high range of ACA and jaw the live wire to read. If the reading is relatively small, then transfer to a lower range and read the LCD.

Note: make the two parts of the clamp jaws close while testing or the reading is not accurate.

4.6 AC voltage and DC voltage Measurement

- 1) Transfer to the 600V range and insert the black test lead into the COM and red test lead into the V.
- 2) When test the DCV, can be tested directly and read on the screen. when test the ACV, press the "SELECT" to the mode of ACV and then read the value on the screen.

5. Maintenance

5.1 Replace Battery



Warnings

Before opening the battery cover of the meter, the test lead shall be moved from the measuring circuit first to prevent the risk of electric shock.

- 1) If "  " symbol appears, it means the battery shall be replaced.
- 2) Screw the fastening screws of the meter battery cover and move away.
- 3) Replace the old battery.
- 4) Install the battery cover as previously.

Note:

Do not violate the battery polarity.

6. Accessories

- | | |
|----------------------|----------|
| 1). Operation Manual | X 1 |
| 2). Test lead | X 1 pair |
| 3). Storage bag | X1 |

Pro'sKit® MT-3100 漏電流鉗形電表使用說明書

1. 聲明

根據國際版權法，未經允許和書面同意，不得以任何形式（包括存儲和檢索或翻譯為其他國家或地區語言）複製本說明書的任何內容。本說明書在將來的版本中如有更改，恕不另行通知。



警告

“警告”標誌表示會對用戶造成危險的狀況和操作。它要求在執行此操作時必須注意，如果不正確執行此操作或不遵守此操作步驟，則可能導致人身傷害或傷亡。在不滿足這些條件或沒有完全理解的情況下，請勿繼續執行警告標誌所指示的任何操作。

使用儀錶前，請仔細閱讀說明書並注意有關安全警告資訊。

2. 安全須知

本儀錶符合 IEC-61010-1、IEC-61010-2-032 電子測量儀器安全儀器要求，過電壓標準 600V CAT II 和污染等級 2 的安全標準。

請遵循本說明書使用儀錶，否則儀錶所提供的保護功能可能會降低或無效。

3. 電氣及安全符號

	警告！注意！
	高壓危險！
	雙絕緣
CAT II	符合 IEC-61010 電子測量儀器安全儀器要求，過電壓標準 600V CAT II 和污染等級 2 的安全標準
CE	符合歐盟 CE 指令

4. 安全操作規範



警告


為了避免可能的觸電或人身傷害，請切實遵守以下的規範：

- 使用儀錶前，請先閱讀“安全須知”。並嚴格按照規定使用儀錶，否則儀錶所提供的保護能力可能會降低或無效。
- 使用儀錶前先檢查外殼。檢查是否存在裂紋或塑膠件缺損。仔細檢查輸入端子附近的絕緣體。
- 若儀錶工作不正常或損壞，請勿使用。
- 應按照指定的測量類別、電壓或電流額定值使用儀錶。
- 當顯示電池電量不足指示時請及時更換電池，以防測量錯誤。
- 請遵守當地和國家的安全規範。穿戴個人防護用品（經認可的橡膠手套、面具和阻燃衣物等），以防危險帶電導體外露時遭受電擊和電弧而受傷。
- 輸入端子間或每個端子與接地點之間施加的電壓不能超過儀錶規定額定值。
- 測量一個已知電壓，以確定儀錶操作是否正常。
- 測量時，必須使用正確的輸入端子、功能檔位和量程檔位。
- 請勿在爆炸性氣體、蒸汽周圍或在潮濕環境中使用儀錶。
- 請勿使用已損壞的錶棒。檢查錶棒絕緣層是否損壞及金屬外露或有磨損，檢查錶棒的通斷性。
- 測量時，請先連接零線或地線，再連接火線；斷開時，請先切斷火線，再斷開零線和地線。

- 測量時，請將手指握在表棒護指裝置的後面。
- 打開儀錶後蓋之前，請先斷開錶棒與被測量物件。
- 請勿在超出儀錶、錶棒或附件中額定值最低的單個元件的測量類別（CAT）額定值的環境中使用儀錶。
- 測量電壓時，請勿輸入超過直流 600V 或交流 600V 峰值的極限電壓。
- 36V 以下的電壓為安全電壓，在測量高於 36V 直流或 25V 交流電壓時，要檢查表筆是否可靠接觸，是否正確連接，是否絕緣良好，以免電擊。

5. 儀錶說明

- ① 鉗頭 電流測量感應器
- ② 鉗頭扳機
- ③ 旋轉開關
- ④ 選擇按鍵
- ⑤ 數據保持按鍵
- ⑥ 顯示屏
- ⑦ 測量插座

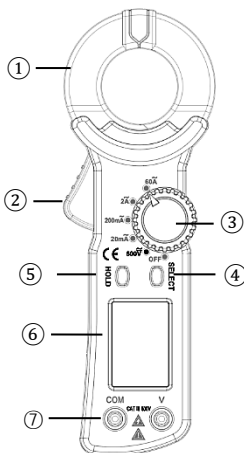

LCD 顯示符號

DC ~AC	直流、交流電壓或電流
	電池不足
	讀數保持狀態
V	電壓單位 伏特
A	電流單位 安培

6. 技術指標

6.1 通用技術指標

- 使用環境條件:
 - IEC-61010-1 · IEC-61010-2-030 · IEC-61010-2-032 600V CAT II · 污染等級 2
 - 海拔高度 < 2000 m
 - 工作環境溫濕度：18~28°C (<75% RH)
 - 儲存環境溫濕度：-10~50°C (<70% RH, 取出電池)
- 溫度係數：0.1×準確度/°C

- 測量端和地之間允許的最大電壓：600V 直流或交流有效值
- 採樣速率：約 3 次/秒
- 顯示：3 1/2 位液晶顯示幕，最大顯示 1999
- 鉗口開口尺寸：30mm
- 超量程指示：液晶顯示器將顯示 “OL” 或 “-OL”
- 電池低壓指示：當電池電壓低於正常工作電壓時，液晶顯示 “ ”。
- 輸入極性指示：自動顯示 “-” 號代表負極
- 自動關機時間：15 分鐘
- 電源：2x1.5V AAA 電池
- 外形尺寸：183×63×29mm
- 機身重量：136g(不含電池)

6.2 交流電流

量程	解析度	準確度
20mA	0.01mA	± (2.5%讀數+ 5 字)
200mA	0.1mA	
2A	0.001A	
60A	0.1A	± (3%讀數+ 8 字)

- 最小輸入電流：0.1mA AC 電流；最大輸入電流：60mA AC 電流
- 頻率響應範圍：45~400Hz

6.2 直流/交流電壓

量程	解析度	準確度
DC 600V	1V	± (1.5%讀數+5 字)
AC 600V	1V	± (1.5%讀數+5 字)

最小輸入電壓：5V；最大輸入電壓：600V DC/AC

ACV 頻率響應範圍：45Hz-1kHz,

7. 操作指南

➤ 7.1 開機及測量準備

撥動測量旋轉開關，開機。如果電池電壓不足（約≤2.4V），顯示器將顯示 “ ” 符號，此時應更換電池。

➤ 7.2 讀數保持

在測量的過程中，如需要讀數保持，輕觸 “Hold” 鍵，顯示器的顯示值將被鎖住，再次輕觸 “Hold” 鍵，可解除讀數保持。

➤ 7.3 自動關機

- 1) 開機後的 15 分鐘內無任何操作時，儀錶會進入休眠狀態，自動關機以節省電能，自動關機後，按任意鍵，喚醒儀錶進入工作狀態。
- 2) 取消自動關機：按 HOLD 鍵同時開機，取消自動關機功能。

➤ 7.4 交流漏電流測量和三相不平衡漏電流測量

1) PE 地線漏電流測量

 
檢測接地線(PE)上的漏電流：將旋轉開關撥至交流電流最高量程，打開扳機，將鉗頭夾住地線，當讀數較小時，可將旋轉開關撥至低量程檔，然後在 LCD 上讀取數據，即為該地線上的漏電流值。

2) 交流三相不平衡電流測量


檢測不平衡工作電源線的漏電流：打開扳機，將鉗頭夾住電源線（單相交流電‘兩根’；三相三線制‘三根’；三相四線制‘四根’）。如果有接地線，不能將地線一起鉗入鉗夾。

■ **注意：**許多工廠或公司採用三相五線制，除了三根相線外，還有一根工作零線和一根保護零線（接地線），在檢測漏電流時，接地線要單獨檢測，不能與四根工作電源線同時夾在鉗夾內。


(圖 1) 單相交流電




(圖 2) 三相三線制

 

(圖 3) 三相四線制

 

(圖 4) 三相五線制

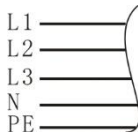

注：L 為火線 N 為零線 PE 為地線

➤ 7.5 交流電流測量

在進行交流電流測量時，將旋轉開關撥至交流電流最高量程，打開扳機，將鉗夾鉗住其中一根火線（相線），並將導線處於鉗夾中心位置，當讀數較小時，可將旋轉開關撥至低量程檔，然後從螢幕上讀取數據。

■ **注意：**測量電流時，兩鉗夾應緊密碰合，不能有間隙，否則測量值將不準確。
為獲得準確的讀數，應盡可能使被測導線處於電流鉗中心位置。

➤ 7.6 直流電壓或交流電壓測量

本儀錶直流或交流電壓量程為：DC/AC 600V

測量交流或直流電壓：

- 1)將旋轉開關旋至  V 檔位,按 SELECT 鍵選擇 DCV 或 ACV 測量。
- 2)分別把黑色錶棒和紅色錶棒連接到 COM 插座和 V/ Ω 輸入插座。
- 3)用錶棒兩端測量待測電路的電壓值（與待測電路並聯）。
- 4)液晶顯示測量電壓值。在測量直流電壓時,顯示器會同時顯示紅色錶棒所連接的電壓極性。

8. 保養

●更換電池

- 1)如果 “  ” 符號出現，表明應更換電池。
- 2)旋開儀錶電池蓋的緊固螺釘並將其移開。
- 3)將舊電池更換。
- 4)將電池蓋按原樣裝上。

注意：

電池的極性不可裝反。

●更換錶棒



警告

更換錶棒時，必須更換同樣的或相同等級的錶棒。錶棒必須完好，若錶棒絕緣層損壞，如導線的金屬絲裸露，必須更換錶棒。

9. 附件

- | | |
|-----------|----------|
| 1). 使用說明書 | X 1 |
| 2). 測量錶棒 | X 1 pair |
| 3). 牛津布包 | X 1 |

Pro'sKit® MT-3100 漏电流钳形电表使用说明书

1. 声明

根据国际版权法，未经允许和书面同意，不得以任何形式（包括存储和检索或翻译为其他国家或地区语言）复制本说明书的任何内容。本说明书在将来的版本中如有更改，恕不另行通知。



警告

“警告”标志表示会对用户造成危险的状况和操作。它要求在执行此操作时必须注意，如果不正确执此行操作或不遵守此操作步骤，则可能导致人身伤害或伤亡。在不满足这些条件或没有完全理解的情况下，请勿继续执行警告标志所指示的任何操作。

使用仪表前，请仔细阅读说明书并注意有关安全警告信息。

2. 安全须知

本仪表符合 IEC-61010-1, IEC-61010-2-032 电子测量仪器安全仪器要求，过电压标准 600V CAT II 和污染等级 2 的安全标准。

请遵循本说明书使用仪表，否则仪表所提供的保护功能可能会降低或无效。

3. 电气及安全符号

	警告! 注意!
	高压危险!
	双绝缘
CAT II	符合 IEC-61010 电子测量仪器安全仪器要求，过电压标准 600V CAT II 和污染等级 2 的安全标准
CE	符合欧盟 CE 指令

4. 安全操作规范



警告

为了避免可能的触电或人身伤害，请切实遵守以下的规范：


- 使用仪表前，请先阅读“安全须知”。并严格按照规定使用仪表，否则仪表所提供的保护能力可能会降低或无效。
- 使用仪表前先检查外壳，检查是否存在裂纹或塑料件缺损。请仔细检查输入端子附近绝缘体。
- 若仪表工作不正常或损坏，请勿使用。
- 应按照指定的测量类别、电压或电流额定值使用仪表。
- 当显示电池电量不足指示时请及时更换电池，以防测量错误。
- 请遵守当地和国家的安全规范。穿戴个人防护用品（经认可的橡胶手套、面具和阻燃衣物等），以防危险带电导体外露时遭受电击和电弧而受伤。
- 输入端子间或每个端子与接地点之间施加的电压不能超过仪表规定额定值。
- 测量一个已知电压，以确定仪表操作是否正常。
- 测量时，必须使用正确的输入端子、功能档位和量程档位。
- 请勿在爆炸性气体、蒸汽周围或在潮湿环境中使用仪表。
- 请勿使用已损坏的表棒。检查表棒的绝缘层是否损坏及金属外露或磨损迹象，检查表棒的通断

性。

- 测量时，请先连接零线或地线，再连接火线；断开时，请先切断火线，再断开零线和地线。
- 测量时，请将手指握在表棒护指装置的后面。
- 打开仪表后盖之前，请先断开表棒与被测量物件。
- 请勿在超出仪表、表棒中额定值最低的单个组件的测量类别（CAT）额定值的环境中使用仪表。
- 测量电压时，请勿输入超过直流 600V 或交流 600V 峰值的极限电压。
- 36V 以下的电压为安全电压，在测量高于 36V 直流或 25V 交流电压时，要检查表笔是否可靠接触，是否正确连接，是否绝缘良好，以免电击。

5. 仪表说明

- ① 钳头 电流测量传感器
- ② 钳头扳机
- ③ 旋转开关
- ④ 选择按键
- ⑤ 数据保持按键
- ⑥ 显示屏
- ⑦ 测量插座

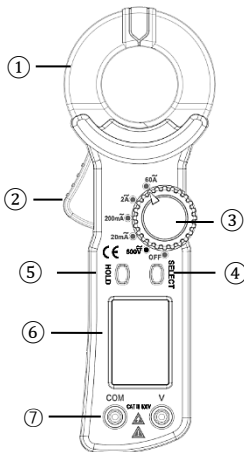

LCD 显示符号

DC ~ AC	直流、交流电压或电流
	电池不足
	读数保持状态
V	电压单位 伏特
A	电流单位 安培

6. 技术指标

6.1 通用技术指标

- 使用环境条件:
 - IEC-61010-1, IEC-61010-2-030, IEC-61010-2-032 600V CAT II, 污染等级 2
 - 海拔高度 < 2000 m
 - 工作环境温湿度: 18~28℃ (<75% RH)
 - 储存环境温湿度: -10~50℃ (<70% RH, 取出电池)

- 温度系数: 0.1×准确度/℃
- 测量端和地之间允许的最大电压: 600V 直流或交流有效值
- 采样速率: 约 3 次/秒
- 显示: 3 1/2 位液晶显示屏, 最大显示 1999
- 钳口开口尺寸: 30mm
- 超量程指示: 液晶显示器将显示“OL”或“-OL”
- 电池低压指示: 当电池电压低于正常工作电压时, 液晶显示“ ”。
- 输入极性指示: 自动显示“-”号代表负极
- 自动关机时间: 15 分钟
- 电源: 2x1.5V AAA 电池
- 外形尺寸: 183×63×29mm
- 机身重量: 136g(不含电池)

6.2 交流电流

量程	分辨力	准确度
20mA	0.01mA	± (2.5%读数+ 5 字)
200mA	0.1mA	
2A	0.001A	
60A	0.1A	± (3%读数+ 8 字)

- 最小输入电流: 0.1mA AC 电流; 最大输入电流: 60mA AC 电流
- 频率响应范围: 45~400Hz

6.2 直流/交流电压

量程	分辨力	准确度
DC 600V	1V	± (1.5%读数+5 字)
AC 600V	1V	± (1.5%读数+5 字)

最小输入电压: 5V; 最大输入电压: 600V DC/AC

ACV 频率响应范围: 45Hz-1kHz,

7. 操作指南

➤ 7.1 开机及测量准备

拨动测量旋转开关, 开机。如果电池电压不足 (约 $\leq 2.4V$), 显示器将显示“ ”符号, 此时应更换电池。

➤ 7.2 读数保持

在测量的过程中, 如需要读数保持, 轻触“Hold”键, 显示器的显示值将被锁住, 再次轻触“Hold”键, 可解除读数保持。

➤ 7.3 自动关机

- 1) 开机后的 15 分钟内无任何操作时，仪表会进入休眠状态，自动关机以节省电能，自动关机后，按任意键，唤醒仪表进入工作状态。
- 2) 取消自动关机：按 HOLD 键同时开机，取消自动关机功能。

➤ 7.4 交流漏电流测量和三相不平衡漏电流测量

1) PE 地线漏电电流测量

 
检测接地线(PE)上的漏电流：将旋转开关拨至交流电流最高量程，打开扳机，将钳头夹住地线，当读数较小时，可将旋转开关拨至低量程档，然后在 LCD 上读取数据，即为该地在线的漏电流值。

2) 交流三相不平衡电流测量


检测不平衡工作电源线的漏电流：打开扳机，将钳头夹住电源线（单相交流电‘两根’；三相三线制‘三根’；三相四线制‘四根’）。如果有接地线，不能将地线一起钳入钳夹。

■ **注意：**许多工厂或公司采用三相五线制，除了三根相线外，还有一根工作零线和一根保护零线（接地线），在检测漏电流时，接地线要单独检测，不能与四根工作电源线同时夹在钳夹内。


(图 1) 单相交流电




(图 3) 三相四线制

 

(图 2) 三相三线制

 

(图 4) 三相五线制

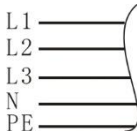

注：L 为火线 N 为零线 PE 为地线

➤ 7.5 交流电流测量

在进行交流电流测量时，将旋转开关拨至交流电流最高量程，打开扳机，将钳夹钳住其中一根火线（相线），并将导线处于钳夹中心位置，当读数较小时，可将旋转开关拨至低量程文件，然后从屏幕上读取数据。

■ **注意：**测量电流时，两钳夹应紧密碰合，不能有间隙，否则测量值将不准确。

为获得准确的读数，应尽可能使被测导线处于电流钳中心位置。

➤ 7.6 直流电压或交流电压测量

本仪表直流或交流电压量程为：DC/AC 600V

测量交流或直流电压：

- 1) 将旋转开关旋至  V 档位, 按 SELECT 键选择 DCV 或 ACV 测量。
- 2) 分别把黑色表棒和红色表棒连接到 COM 插座和 V/ Ω 输入插座。
- 3) 用表棒另两端测量待测电路的电压值（与待测电路并联）。
- 4) 液晶显示测量电压值。在测量直流电压时, 显示器会同时显示红色表棒所连接的电压极性。

8. 保养

●更换电池

- 1) 如果 “ ” 符号出现，表明应更换电池。
- 2) 旋开仪表电池盖的紧固螺钉并将其移开。
- 3) 将旧电池更换。
- 4) 将电池盖按原样装上。

注意：

电池的极性不可装反。

●更换表棒



警告

更换表棒时，必须更换同样的或相同等级的表棒。表棒必须完好，若表棒绝缘层损坏，如导线的金属丝裸露，必须更换表棒。

9. 附件

- | | |
|-----------|----------|
| 1). 使用说明书 | X 1 |
| 2). 测量表棒 | X 1 pair |
| 3). 牛津布包 | X 1 |

Pro'sKit® 中国地区产品保固卡

购买日期		店章
公司名称		
联络电话		
电子邮箱		
联络地址		
产品型号	☐ MT-3100-C	

- ※ 在正常使用情况下，自原购买日起 12 个月免费维修保证（不含耗材、消耗品）。
※ 产品保固卡需盖上店章、日期章，其保固效力始生效。
※ 本卡请妥善保管，如需维修服务时，请出示本卡以为证明。
※ 保固期满后，属调整、保养或是维修性质之服务，则酌收检修工时费用。若有零件需更换，则零件费另计。

产品保固说明

1. 保固期限内，如有下列情况者，维修中心则得酌收材料成本或修理费(由本公司维修人员判定):
 - 产品表面的损伤，包括外壳裂缝或刮痕。
 - 误用、疏忽、不当安装或测试，未经授权打开产品修理，修改产品或者任何其他超出预期使用范围的原因所造成的损害。
 - 因事故、火灾、电力变化、其他危害，或自然灾害所造成的损害。
2. 非服务保证内容：
 - 机件本体外之消耗品：如电池等消耗品
 - 机件本体外之之附配件：如表笔、温度测量感温探头、保险丝等附配件。
3. 超过保证期限之检修或服务, 虽未更换零件，将依公司保固维修政策酌收服务费。

上海宝工工具有限公司

地址：上海市浦东新区康桥东路1365弄25号

电话：021-68183050/68183051/68183052/68183053

传真：021-68183061

服务热线：400-1699-629

E-mail: sha@mail.prokits.com.tw

Pro'sKit®

寶工實業股份有限公司



PROKIT'S INDUSTRIES CO., LTD

<https://www.proskit.com>

E-mail: pk@mail.prokits.com.tw

©2026 Prokit' s Industries Co., Ltd. All rights reserved. 2026001